Technical Bulletin No: 27-2016



Title:	HireTech HT7 Edging Sander Maintenance
Priority	Amber – Non-Conformance Minor – Major in some instances
Legislation:	PUWER, E@WR
Brief	During SafeHire audits a range of issues have been identified due to poor maintenance on
Description:	HT7 sanders. This bulletin covers the most common issues that should be addressed.
Equipment	HireTech HT7 Edging Sander
Affected:	

1 – Castors locknut loose, poorly adjusted, castors tight in operation 2- Gearbox breather hole blocked / covered with company decal

3 – Cable worn through / arctic cable used rather than H07



4 - Switch sticking in on position should be momentary



5- Top cover cracked / broken replace



6 -Incorrect wiring - trapped between frame and cover



7 - Skirting protector seized, should freely rotate



8- Multiple discs fitted as height incorrectly set



9 - Poor plug wiring / fuse clip loose - see Tech Bulletin 8







V1

Recommended **Actions:**

- Review above with workshop teams / audit ready for hire equipment
- Use H07 or equivilent cable with minimum 1.5mm² cores
- Consider installing a suitable connector to ease cable replacement when cleint 'sands' the cable – 10 amp for 230v as per link below. 16 amp is required for 110v.
- http://uk.rs-online.com/web/p/mains-inline-connectors/0531431/

Circulation: Management / Workshop Team

HireTech HT7 Edging **Bulletin** Creation Title: 27 - 2016 15/09/2016 Sander Maintenance Number: Date: Authors: TfH Ltd Reviewed by: Revision: